

Fiume Mincio

Opere idrauliche di II categoria

MN-E-394-M

CUP: **B64H15000070002**

CIG:



**Regione
Lombardia**



Progetto Definitivo / Esecutivo

Lotto A

ELABORATO

Verifica del rischio di liquefazione

UBICAZIONE OPERE

Comune di Mantova
Località Ponte dei Mulini

DATA: Agosto 2018

AGG. -

SCALA:

-

COMMITTENTE

AIPO - Ufficio operativo di Mantova

Vicolo Canove, 26 - 46100 Mantova

tel. + 39 0376320461

fax. + 39 0376320464

e-mail: ufficio-mn@agenziapo.it

Raggruppamento temporaneo d'impresa

POLARIS - STUDIO ASSOCIATO



HYDRODATA S.p.a.



ENGEO S.r.l.



SAP S.r.l.



Responsabile unico del procedimento

Ing. Ivano Galvani

Il Coordinatore alla Progettazione

Ing. Marcello Moretti

Assistente

Dott. Paolo Michelini

Lavori di ripristino funzionale del manufatto a sostegno del Lago Superiore denominato "Vasarone", a seguito degli eventi sismici del 20 e 29 maggio 2012

2.b.12




Project: Lavori di ripristino funzionale del manufatto a sostegno del Lago Superiore "Vasarone"

Location: Porta Mulina - Mantova

CPT: CPTU_2

Total depth: 30.00 m

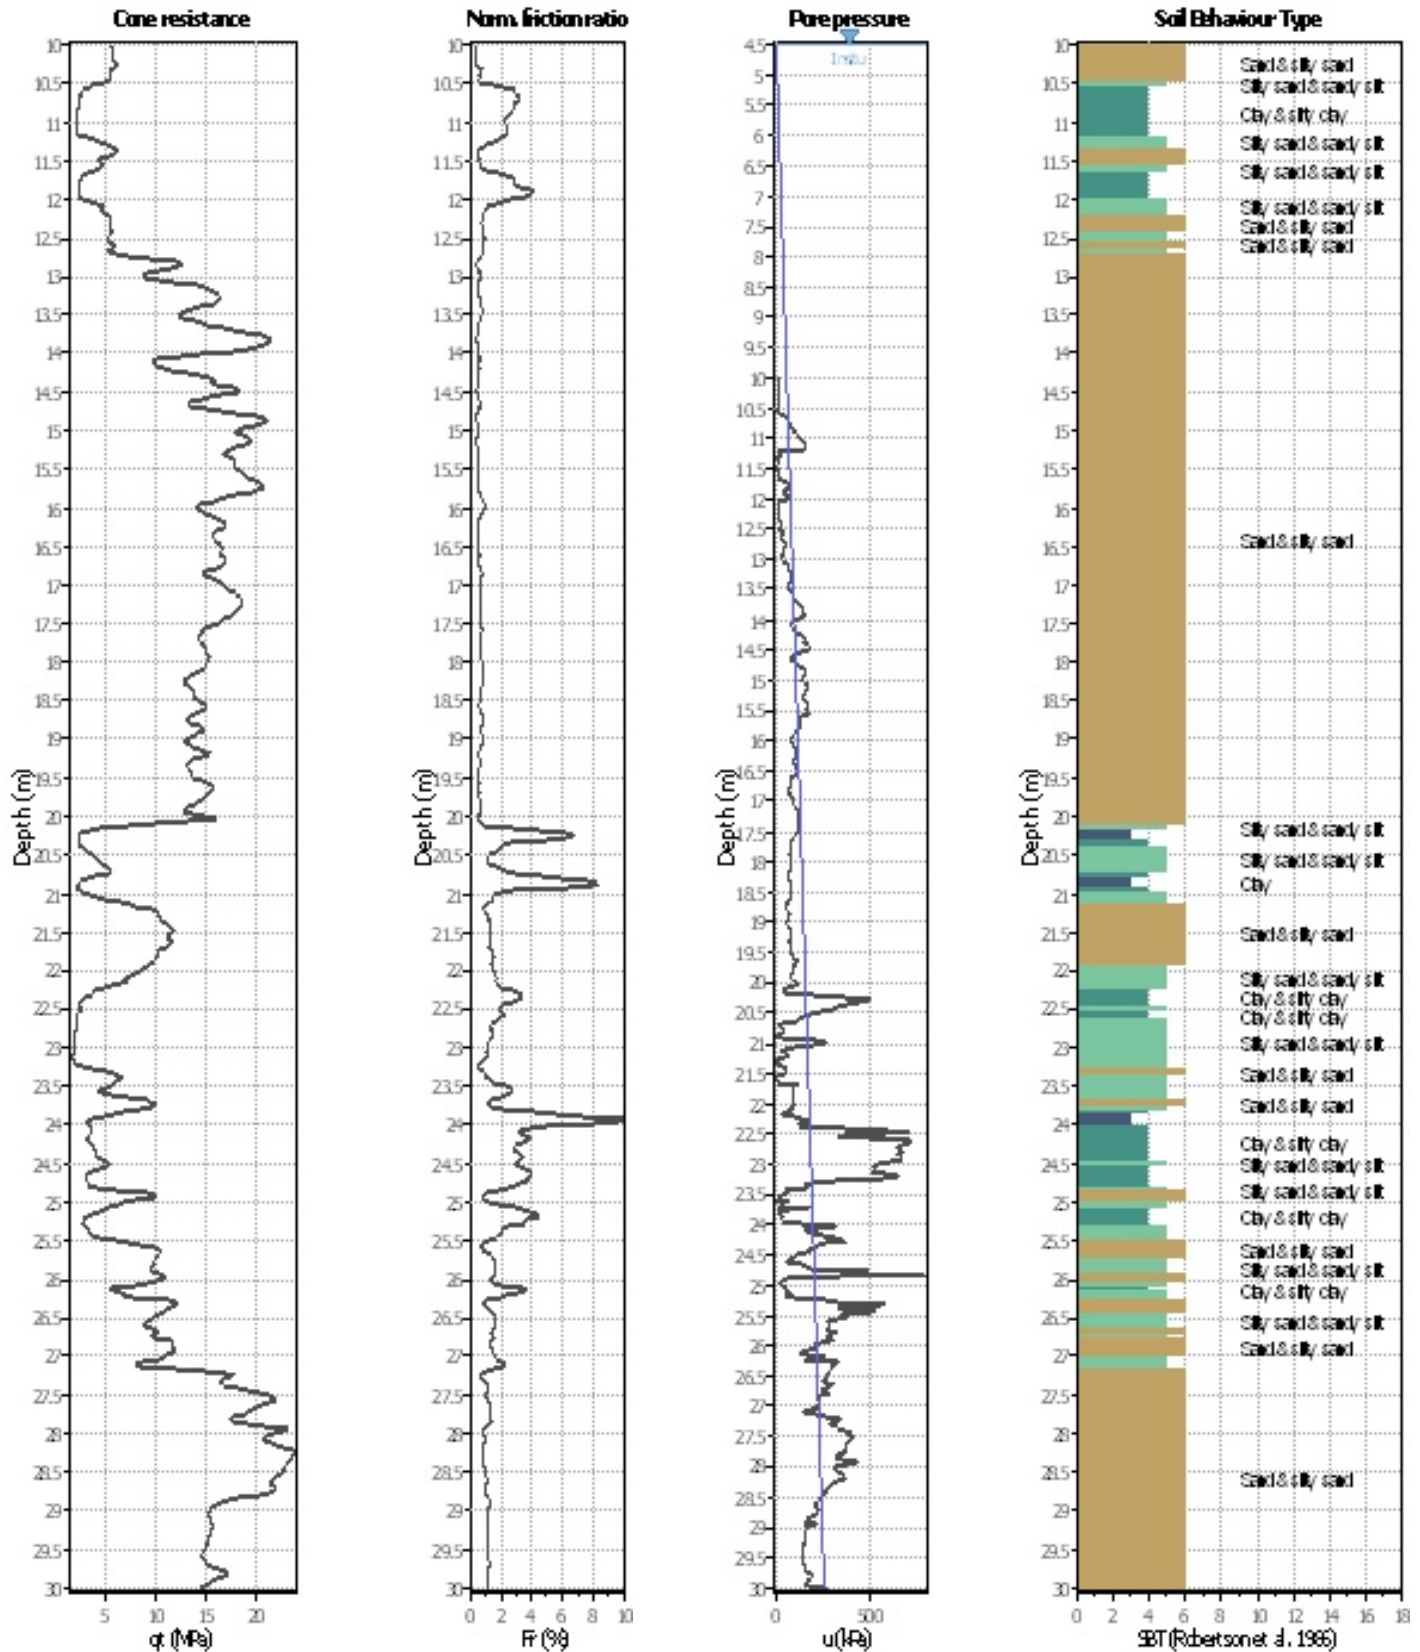

Analysis method:	NCEER (1998)	G.W.T. (in-situ):	4.50 m	Use fill:	No	Clay like behavior	
Fines correction method:	NCEER (1998)	G.W.T. (earthq.):	2.50 m	Fill height:	N/A	applied:	Sands only
Points to test:	Based on Ic value	Average results interval:	3	Fill weight:	N/A	Limit depth applied:	No
Earthquake magnitude M_w :	6.45	Ic cut-off value:	2.60	Trans. detect. applied:	Yes	Limit depth:	N/A
Peak ground acceleration:	0.15	Unit weight calculation:	Based on SBT	K_0 applied:	Yes	MSF method:	Method based




Project: Lavori di ripristino funzionale del manufatto a sostegno del Lago Superiore "Vasarone"

Location: Porta Mulina - Mantova

CPT: CPTU_2

Total depth: 30.00 m

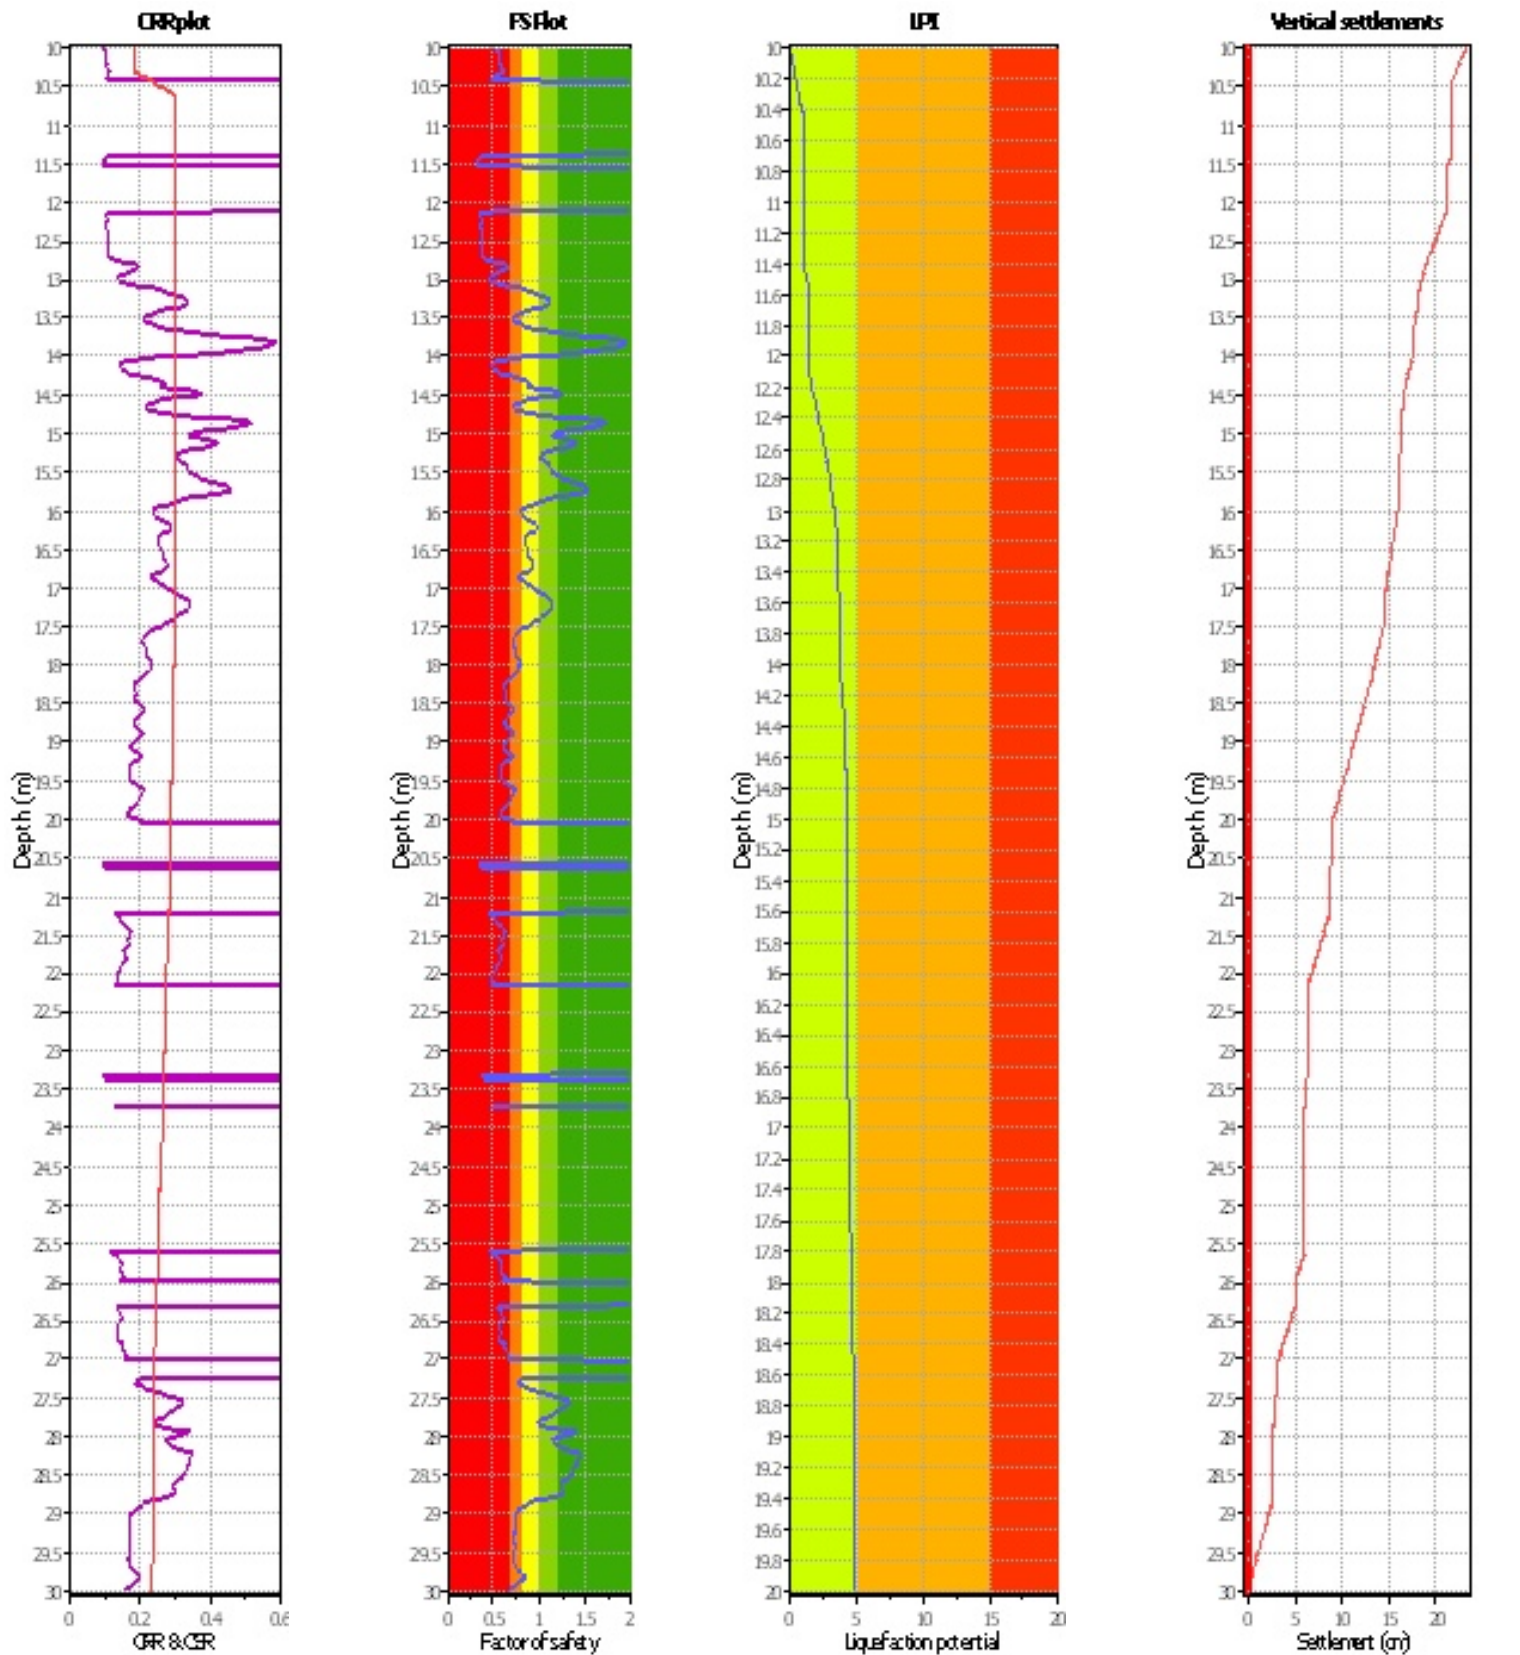

Analysis method:	NCEER (1998)	G.W.T. (in-situ):	4.50 m	Use fill:	No	Clay like behavior	
Fines correction method:	NCEER (1998)	G.W.T. (earthq.):	2.50 m	Fill height:	N/A	applied:	Sands only
Points to test:	Based on Ic value	Average results interval:	3	Fill weight:	N/A	Limit depth applied:	No
Earthquake magnitude M_w :	6.45	Ic cut-off value:	2.60	Trans. detect. applied:	Yes	Limit depth:	N/A
Peak ground acceleration:	0.15	Unit weight calculation:	Based on SBT	K_0 applied:	Yes	MSF method:	Method based




Project: Lavori di ripristino funzionale del manufatto a sostegno del Lago Superiore "Vasarone"

Location: Porta Mulina - Mantova

CPT: SCPTU_1

Total depth: 15.80 m

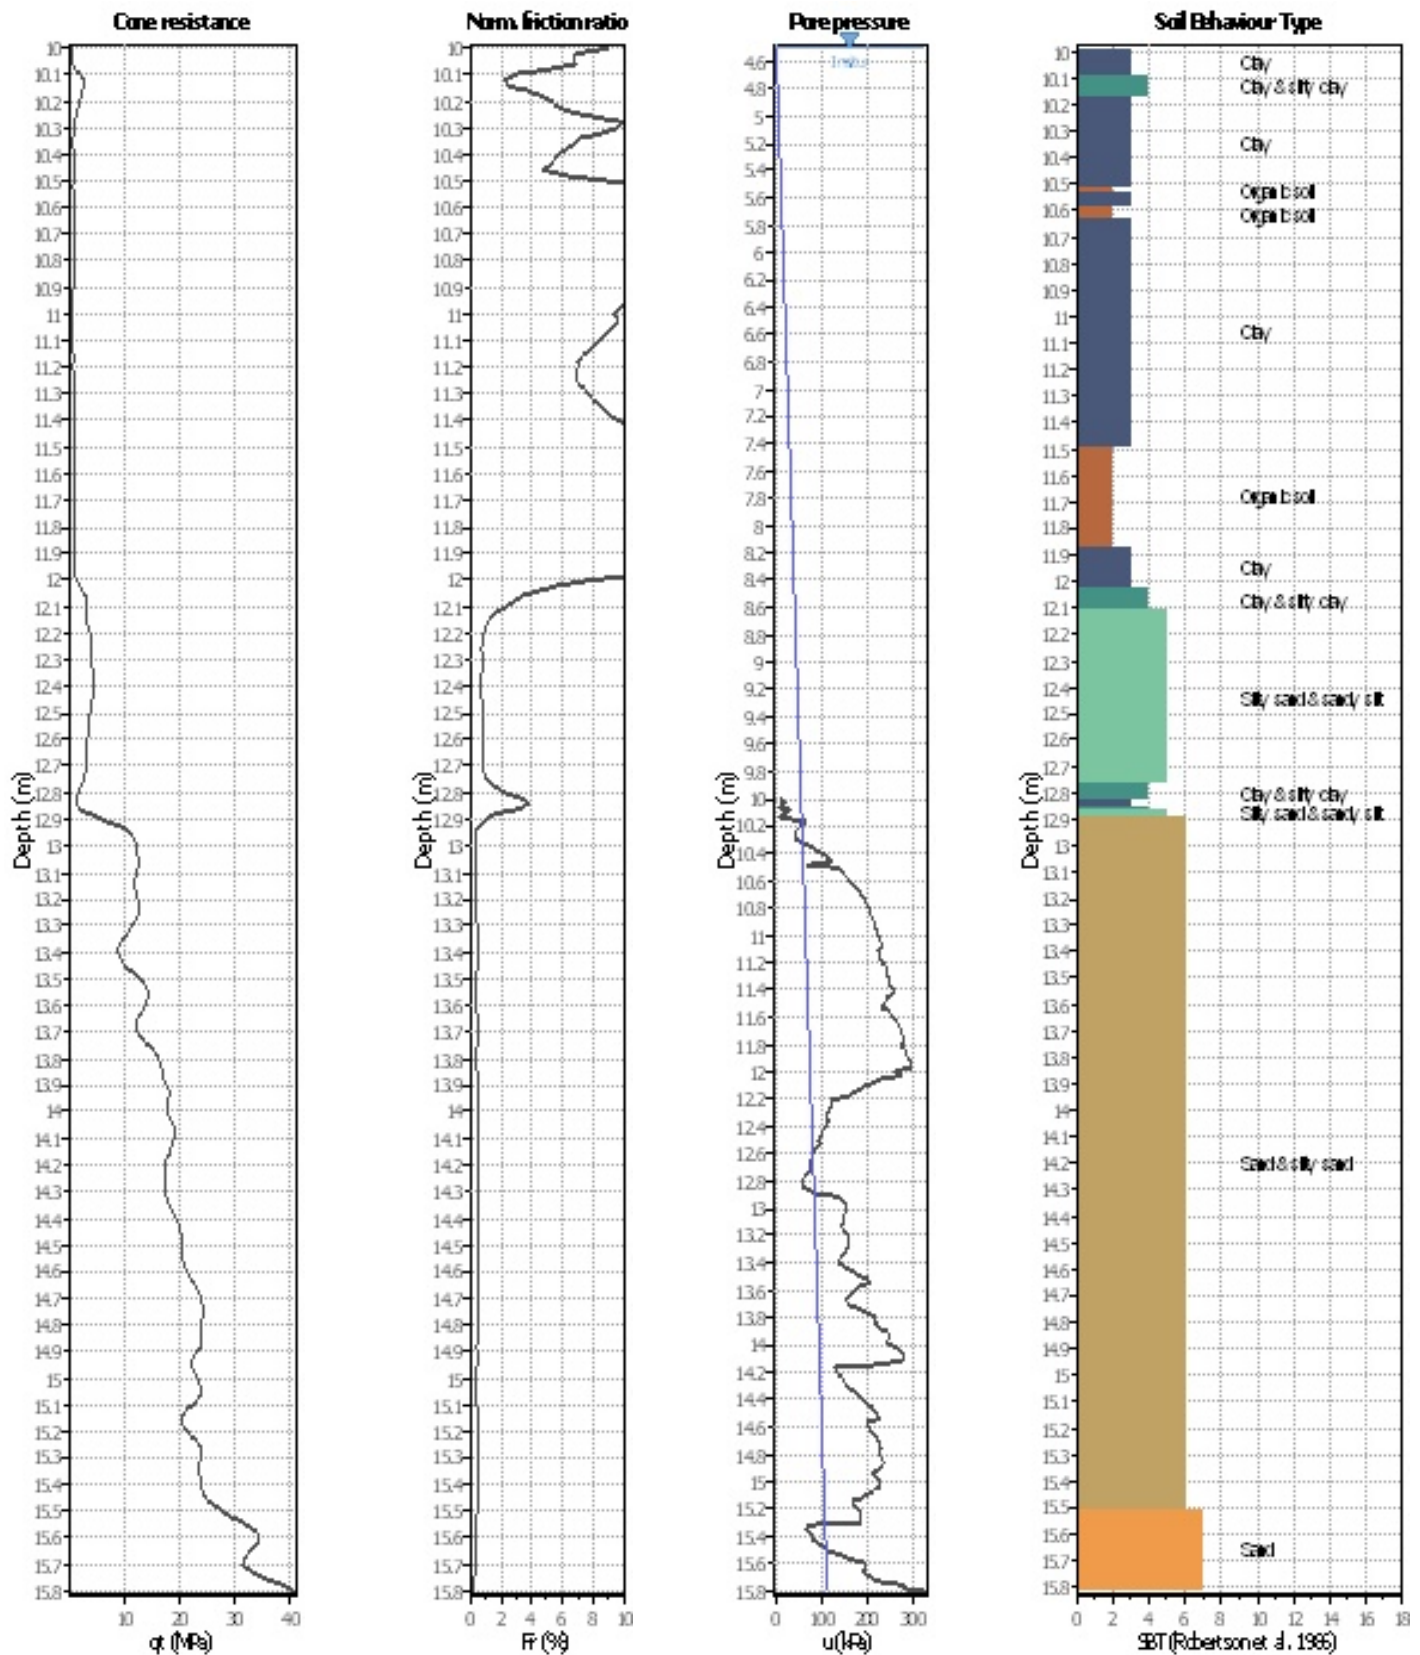

Analysis method:	NCEER (1998)	G.W.T. (in-situ):	4.50 m	Use fill:	No	Clay like behavior	
Fines correction method:	NCEER (1998)	G.W.T. (earthq.):	2.50 m	Fill height:	N/A	applied:	Sands only
Points to test:	Based on Ic value	Average results interval:	3	Fill weight:	N/A	Limit depth applied:	No
Earthquake magnitude M_w :	6.60	Ic cut-off value:	2.60	Trans. detect. applied:	Yes	Limit depth:	N/A
Peak ground acceleration:	0.18	Unit weight calculation:	Based on SBT	K_0 applied:	Yes	MSF method:	Method based




Project: Lavori di ripristino funzionale del manufatto a sostegno del Lago Superiore "Vasarone"

Location: Porta Mulina - Mantova

CPT: SCPTU_1

Total depth: 15.80 m

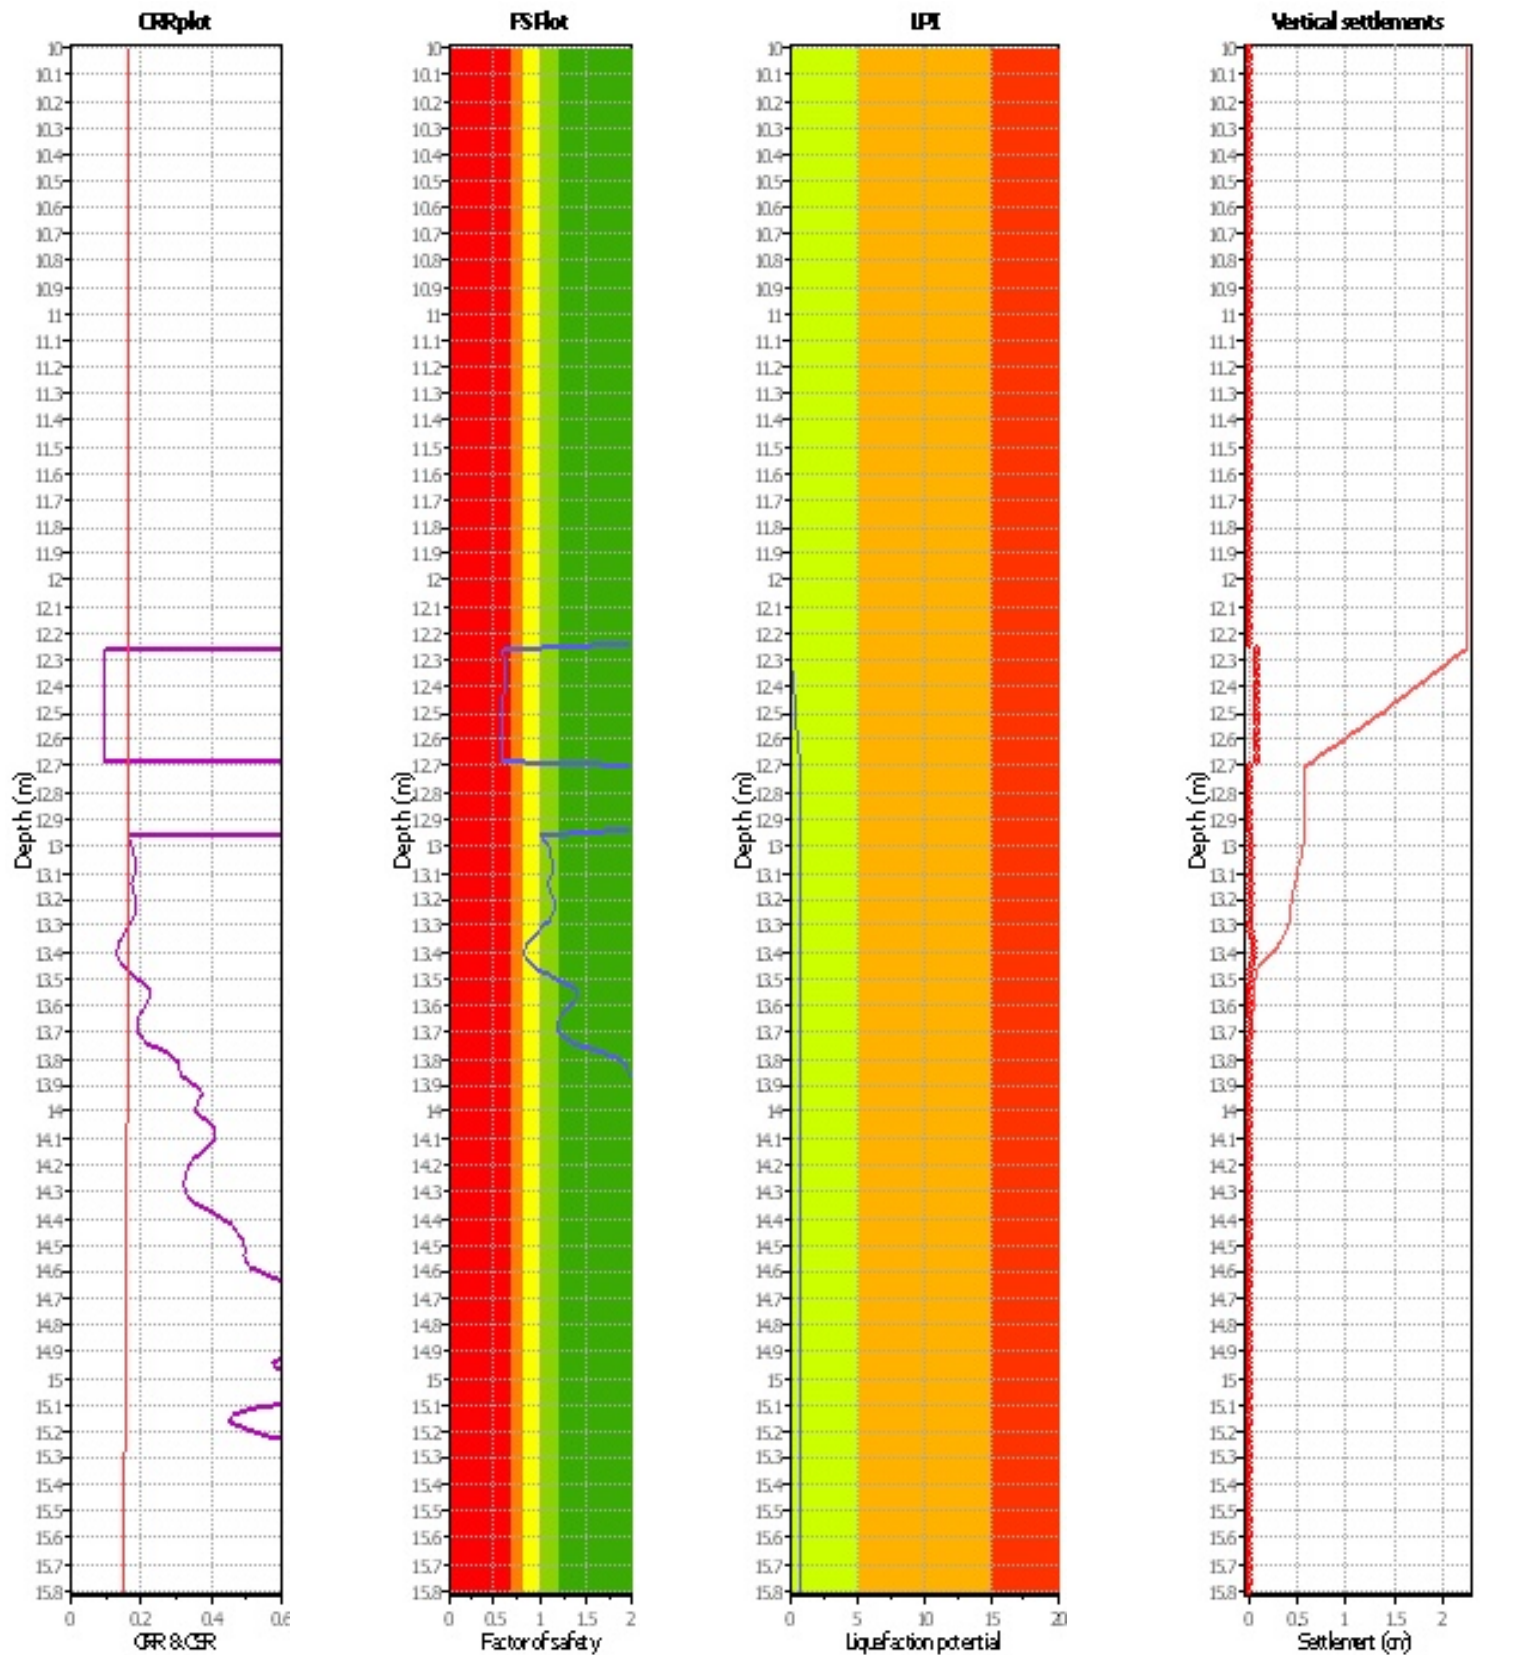

Analysis method:	NCEER (1998)	G.W.T. (in-situ):	4.50 m	Use fill:	No	Clay like behavior	
Fines correction method:	NCEER (1998)	G.W.T. (earthq.):	2.50 m	Fill height:	N/A	applied:	Sands only
Points to test:	Based on Ic value	Average results interval:	3	Fill weight:	N/A	Limit depth applied:	No
Earthquake magnitude M_w :	6.60	Ic cut-off value:	2.60	Trans. detect. applied:	Yes	Limit depth:	N/A
Peak ground acceleration:	0.18	Unit weight calculation:	Based on SBT	K_0 applied:	Yes	MSF method:	Method based